

PRODUCT AFFECTED:

JUNO-60/6

TO SERVICE ENGINEERS:


SUBJECT

A Failure of IC 3R01

This information is our advice so that you may save a repair time for JUNO-60/6 related to IC 3R01 and may not have the same on a product from the same customer repeatedly, and this one should be applied to the both models with following serial numbers:

JUNO-60 : From S/No.317300 to 321299
JUNO-6 : From S/No.313700 to 324199

From our repair record in Japan market, it was found that some IC 3R01 in JUNO-60/6 became in failure and it was caused by a crack which happened on the molded package of the IC.

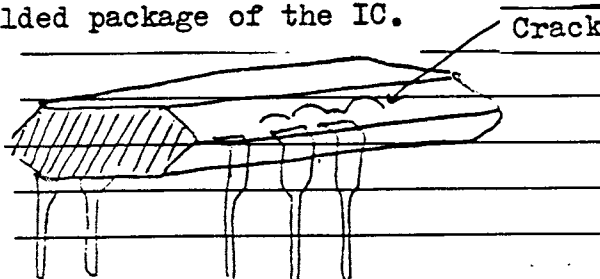

It seems that there is a possibility for IC 3R01 to be mixed in JUNO-60/6 with above serial numbers. We wish you to pay your attention to IC 3R01 when you have a chance to repair them. We advise you to replace the IC with a crack with new one which is sent under separate air service, even though the IC works normally, if you would find it.

NOTE : JUNO-60/6 show a phenomenon as shown below on each function if one of IC 3R01 are in failure:

VCA ENV. : Output volume does not change, or sometimes it change, or output sound leaks, or no output sound.

VCF ENV. : Sound does not change by ENV MOD., or sometimes it change.

DCO PWM. : Sound does not change by MOD ENV., or sometimes it change.

NOTE : 6 pcs of IC 3R01 have been used in a JUNO-6/60.

NOTE : We finished checking all JUNO-60/6 in our factory already and the checked JUNO-60/6 has P mark on the carton.

Handwritten signature/initials